


## To update the Web Server 01945-01946

**WARNING:** To upgrade a Web Server with software version prior to 1.5 installed in a system where there is a control device loads and where the function of Energy Guard is disabled, proceed to its activation (by setting values also fictitious) using the procedure described by pag. 35 to 38 of the manual installer, this is done the Web Server's firmware can be updated after 24 hours (if you perform this operation, the Web Server can not be upgraded). When the update is complete, you can, if desired, deactivate the Energy Guard.

The procedure for updating the Web Server is as follows:

1. Access the Web Server with Administrator credentials.
2. Access to the General Settings menu by pressing the lower right.
3. Select the item Setup → Update.
4. Click **Choose file** and upload the update file (with .tar.gz extension) from the location where it has been saved; confirm checking the box at the bottom right.
5. Wait for the page and click on the check list at the bottom right.
6. Wait for about 2 minutes and then to refresh the page by pressing **F5** or **Ctrl + R**.  
When upgrading to version 1.15 of a Web Server with an installed version previous to 1.2. where the system data was already set up, after completing the software update it will be necessary to import the XML file of the system to update the Web Server database by following the steps below. This operation is not needed (the Web Server performs it automatically), if the version of the software to be updated is equal to or later than 1.2.
7. Re-access the General Settings menu.
8. Select the item **BY-ME** → Import XML.
9. Load the XML file created with EasyTool Professional installation and perform an update of the project.

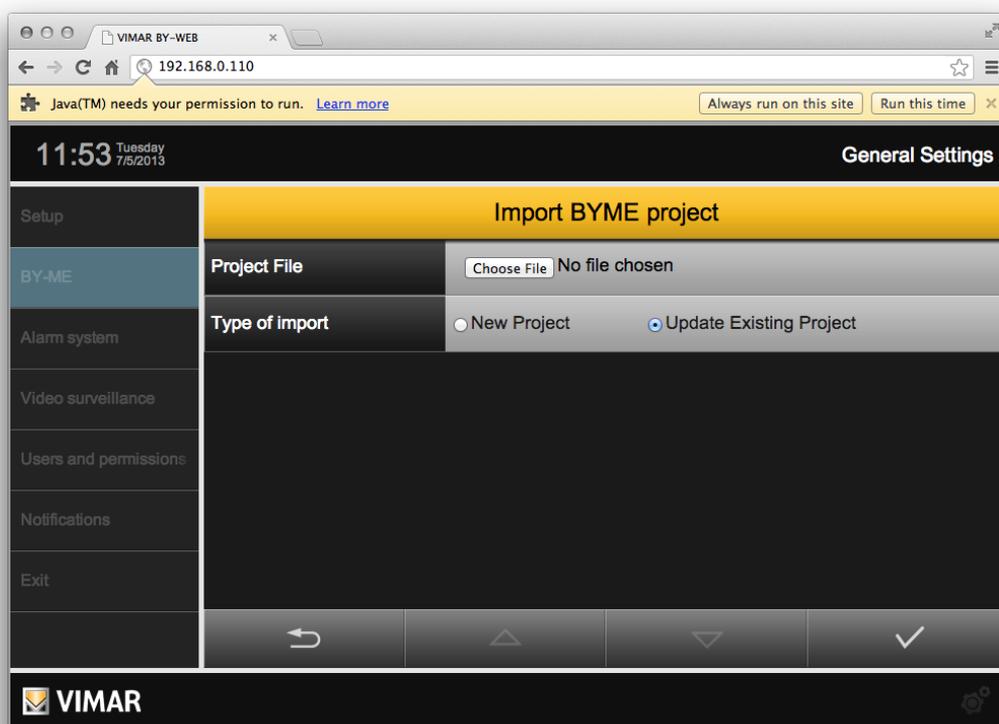

## To update the Web Server 01945-01946

---

10. Wait for the update process of the project.

**IMPORTANT:** This update of the project maintains the set personal configurations (backgrounds, cameras, users, icons, etc..).

### **WEBSERVER NOTES FOR UPDATING FROM VERSION 1.4 (OR EARLIER) TO VERSION 1.15.**

If the system includes Multimedia video touch screen 10 in IP (Code 21553 and 21553.1) devices, to update the web server to version 1.15 you **MUST** follow these steps:

1. Turn off all the 21553 devices in the system.
2. Proceed with the upgrade of the web server, as described above.
3. After the webserver software update and its automatic restart, turn all the 21553 devices back on in the system.

**NB If you have an iPhone on which you installed the App By-Web version 1.4 or earlier, after you upgrade the Web Server, you must download the new version of the app from the iTunes site taking care to remove the previous version before installing the new one and load at the end of the installation, the design of the plant to exit the demo mode of the App.**

